



USER'S MANUAL

170-205-0016

Pulse-Width Modulated,
Adjustable Speed Drives
for DC Brush Motors

The 170-205-0016 chassis drive accepts a DC input voltage and output a DC power voltage to control the speed of a low voltage motor. The speed may be controlled with a potentiometer or an external voltage signal.

Standard Features:

- Provides smooth variable capability for mobile equipment.
- Maintains variable speed control as batteries discharge.
- Adjustable min speed, max speed, IR compensation, current limit, and accel.
- Inhibit terminal permits optional start-stop without breaking battery lines.
- Speed potentiometer included.
- Increases range or running time of battery operated equipment through high efficiency.
- Power LED gives a visual indication when power is applied to the drive.
- Jumper reconnectable for low or high voltage.


Copyright © 2006 by
Bison Gear & Engineering

All rights reserved. No part of this manual may be reproduced or transmitted in any form without written permission from Bison Gear & Engineering. The information and technical data in this manual are subject to change without notice. Bison Gear & Engineering and its Divisions make no warranty of any kind with respect to this material, including, but not limited to, the implied warranties of its merchantability and fitness for a given purpose. Bison Gear & Engineering and its Divisions assume no responsibility for any errors that may appear in this manual and make no commitment to update or to keep current the information in this manual. MVD062702

Printed in the United States of America.

Safety Warnings



- This symbol  denotes an important safety tip or warning. **Please read these instructions carefully** before performing any of the procedures contained in this manual.
- **DO NOT INSTALL, REMOVE, OR REWIRE THIS EQUIPMENT WITH POWER APPLIED.** Bison assumes the qualified technician is intimate with the dangers involving batteries, especially lead-acid type. This manual presupposes that you have taken all the necessary precautions to prevent a potentially fatal accident involving such batteries, and have followed all standard electrical precautions.
- Reduce the chance of an electrical fire, shock, or explosion by proper grounding, over-current protection, thermal protection, and enclosure. Follow sound maintenance procedures.



It is possible for a drive to run at full speed as a result of a component failure. Bison strongly recommends the installation of a master switch in the main power input to stop the drive in an emergency.

This drive is isolated from earth ground. Avoid direct contact with the printed circuit board or with circuit elements to prevent the risk of serious injury or fatality. Use a non-metallic screwdriver for adjusting the calibration trimpots. Use approved personal protective equipment and insulated tools if working on this drive with power applied.

Contents

| | |
|---|-----------|
| Safety Warnings | i |
| Specifications | 1 |
| Dimensions | 2 |
| Installation | 3 |
| Mounting | 3 |
| Wiring | 4 |
| Shielding Guidelines | 5 |
| Fuse / Circuit breaker protection | 6 |
| Jumper 501 (JP501) | 6 |
| Speed adjust potentiometer | 7 |
| Connections | 9 |
| Voltage follower | 12 |
| Operation | 13 |
| Before applying power | 13 |
| Startup and shutdown | 14 |
| Starting and stopping methods | 15 |
| Inhibit terminals | 17 |
| Power LED (IL501) | 18 |
| Calibration | 19 |
| MINIMUM SPEED (MIN SPD) | 20 |
| MAXIMUM SPEED (MAX SPD) | 20 |
| ACCELERATION (ACCEL) | 21 |
| IR COMPENSATION (IR COMP) | 22 |
| CURRENT LIMIT (CUR LIMIT) | 23 |

| | |
|--|--------------------------|
| Application Notes | 25 |
| Multiple fixed speeds | .25 |
| Adjustable speeds using potentiometers in series | .26 |
| Independent adjustable speeds | .27 |
| RUN/JOG switch | .28 |
| Reversing | .29 |
| Troubleshooting | 31 |
| Before troubleshooting | .31 |
| Unconditional Warranty | inside back cover |

Illustrations

- Figure 1. 170-205-0016 Dimensions2
- Figure 2. Jumper 501 (JP501)6
- Figure 3. Speed Adjust Potentiometer8
- Figure 4. Speed Adjust Potentiometer Connections8
- Figure 5. Power, Fuse and Motor Armature Connections11
- Figure 6. Voltage Follower Connections12
- Figure 7. Run/Decelerate to Minimum Speed Switch16
- Figure 8. Inhibit Terminals17
- Figure 9. Power LED18
- Figure 10. Calibration Trimpot Layout19
- Figure 11. Approximate CUR LIMIT Settings24
- Figure 12. Multiple Fixed Speeds25
- Figure 13. Adjustable Fixed Speeds Using
Potentiometers in Series26
- Figure 14. Independent Adjustable Speeds27
- Figure 15. RUN/JOG Switch Connection to
Speed Adjust Potentiometer28
- Figure 16. Reversing hookup diagram30

Tables

- Table 1. Wire Gauge/Length Chart4

Specifications



| Model | Max. Armature Current (Amps DC) | Max. Armature Voltage ³ (VDC) | DC Voltage Input Range (VDC) |
|---|--|---|------------------------------------|
| 170-205-0016 | 16 ¹ | 12 or 24 ² | 10-32 |
| Acceleration Time Range | | | 0.5 – 10 seconds |
| Deceleration Time | | | 0.5 seconds |
| Analog Input Voltage Range (signal must be isolated; S1 to S2) | | | 0 – 10 VDC |
| Input Impedance (S1 to S2) | | | 200K Ω |
| Speed Regulation (% of base speed) | | | 1% |
| Speed Range | | | 80:1 |
| Form Factor | | | 1.01 |
| Ambient Operating Temperature Range | | | 10°C – 40°C |
| Weight | | | |
| 170-205-0016 | | | 1.7 lbs |

1 At 40°C ambient. No additional heat sink is necessary.

2 Or up to 95% of available battery voltage.

3 The lower maximum armature voltage is selectable by connecting a jumper to pins 2 and 3 of JP501 (see page 6).

Dimensions

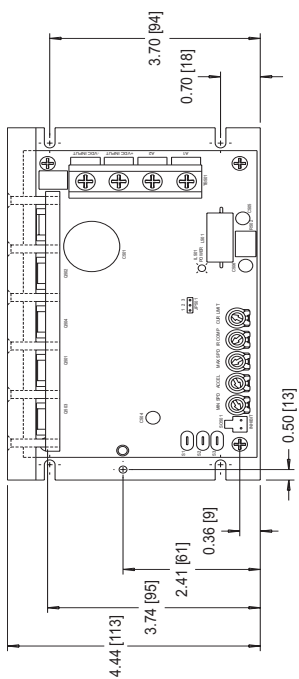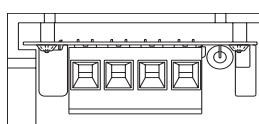

ALL DIMENSIONS IN
INCHES
[MILLIMETERS]

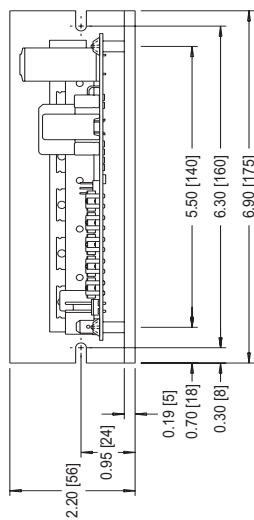


Figure 1. 170-205-0016 Dimensions

Installation

Mounting



Warning

Do not install, rewire, or remove this control with input power applied. Doing so may cause fire or serious injury. Make sure you have read and understood the Safety Warnings on page i before attempting installation.

- Drive components are sensitive to electrostatic fields. Avoid contact with the circuit board directly. Hold drive by the chassis only.
- Protect the drive from dirt, moisture, and accidental contact.
- Provide sufficient room for access to the terminal block and calibration trimpots.
- Mount the drive away from other heat sources. Operate the drive within the specified ambient operating temperature range.
- Prevent loose connections by avoiding excessive vibration of the drive.
- Mount drive with its board in either a horizontal or vertical plane. Six 0.19 in. (5 mm) wide slots in the chassis accept #8 pan head screws. Fasten either the large base or the narrow flange of the chassis to the subplate.

Wiring



Warning



Do not install, remove, or rewire this equipment with power applied. Failure to heed this warning may result in fire, explosion, or serious injury.

S1 shares the same common as -VDC Input. To prevent the risk of injury or fatality, avoid direct contact with the printed circuit board or with circuit elements.

Do not disconnect any of the motor leads from the drive unless power is removed. Opening any one motor lead may destroy the drive.

This drive is not diode-protected from reverse battery voltage. You must assure that POS (+) is wired to +VDC IN and NEG (-) is wired to -VDC IN.

Use 18 AWG wire for speed adjust potentiometer wiring.

- Size the DC voltage input and motor wire according to the following chart:

Table 1. Wire Gauge/Length Chart

| Armature Current (amps) | Wire Gauge (AWG) | Maximum Wire Length (feet) |
|----------------------------|---------------------|-------------------------------|
| 0 – 16 | 14 | 8 |

Shielding guidelines



Warning

Under no circumstances should power and logic leads be bundled together. Induced voltage can cause unpredictable behavior in any electronic device, including motor controls.

As a general rule, Bison recommends shielding of all conductors.

If it is not practical to shield power conductors, Bison recommends shielding all logic-level leads. If shielding of logic level leads is not practical, the user should twist all logic leads with themselves to minimize induced noise.

It may be necessary to earth ground the shielded cable. If noise is produced by devices other than the drive, ground the shield at the drive end. If noise is generated by a device on the drive, ground the shield at the end away from the drive. Do not ground both ends of the shield.

If the drive continues to pick up noise after grounding the shield mount the drive in a less noisy environment.

Logic wires from other input devices, such as motion controllers and PLL velocity controllers, must be separated from power lines in the same manner as the logic I/O on this drive.

Fuse / Circuit breaker protection

All Bison drives should be protected by a fuse or circuit breaker. Use a fast acting fuse or circuit breaker rated for approximately 200% of the maximum armature current and armature voltage. Connect the fuse or circuit breaker to the VDC+ IN side of the DC voltage input.

Jumper 501 (JP501)

The 170-205-0016 drives are shipped with pins 1 and 2 jumpered on JP501. This allows you to use 24 VDC motors. To use 12 VDC DC motors, jumper pins 2 and 3. See Figure 2 for the location of JP501.

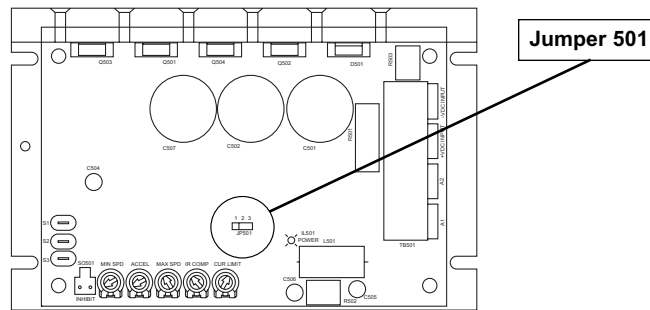


Figure 2. Jumper 501 (JP501)

Speed adjust potentiometer



Warning

Be sure that the potentiometer tabs do not make contact with the potentiometer enclosure. Grounding the input will cause damage to the drive.

Mount the speed adjust potentiometer through a 0.38 in. (10 mm) hole with the hardware provided (see Figure 3 on Page 8). Install the circular insulating disk between the panel and the 10K ohm speed adjust potentiometer.

Twist the speed adjust potentiometer wire to avoid picking up unwanted electrical noise. If speed adjust potentiometer wires are longer than 18 in. (457 mm), use shielded cable. Keep speed adjust potentiometer wires separate from power leads (+VDC, -VDC, A1, A2).

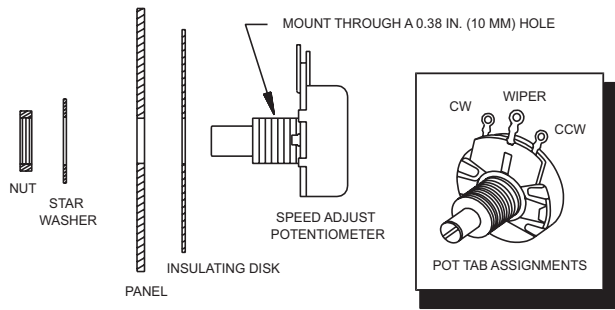


Figure 3. Speed Adjust Potentiometer

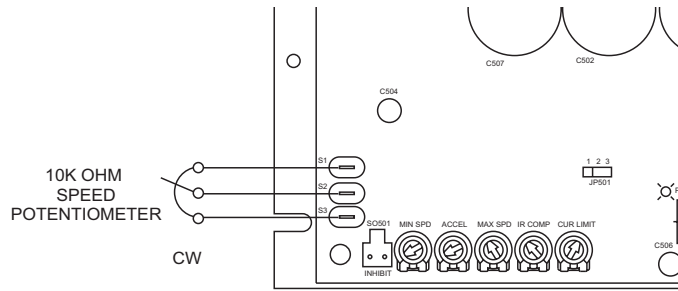


Figure 4. Speed Adjust Potentiometer Connections

Connections



Warning

Do not connect this equipment with power applied. Failure to heed this directive may result in fire or serious injury.

Bison strongly recommends the installation of a master power switch in the voltage input line, as shown in Figure 5, page 11. The switch contacts should be rated at a minimum of 200% of motor nameplate current and 150% of the input voltage.

Power, fuse and motor connections

Connect the power input leads, an external line fuse and a motor to the drive's printed circuit board (PCB) as shown in Figure 5, page 11.

Motor

Bison drives supply motor voltage from A1 and A2 terminals. It is assumed throughout this manual that, when A1 is positive with respect to A2, the motor will rotate clockwise (CW) while looking at the output shaft protruding from the front of the motor. If this is opposite of the desired rotation, simply reverse the wiring of A1 and A2.

Connect a DC motor to PCB terminals A1 and A2 as shown in Figure 5, page 11. **Ensure that the motor voltage rating is consistent with the drive's output voltage.**

Power input



Warning

This drive is not diode-protected from reverse battery voltage. You must assure that POS (+) is wired to +VDC IN and NEG (-) is wired to -VDC IN.

Connect the DC power leads to terminals + VDC IN and - VDC IN, or to a single-throw, single-pole master power switch as shown in Figure 5, page 11 (recommended).

Fuse

Wire a power input fuse between the stop switch (if installed) and the + VDC IN terminal on the circuit board. The fuse should be rated at 150% of input voltage and 150 - 200% of maximum motor nameplate current.

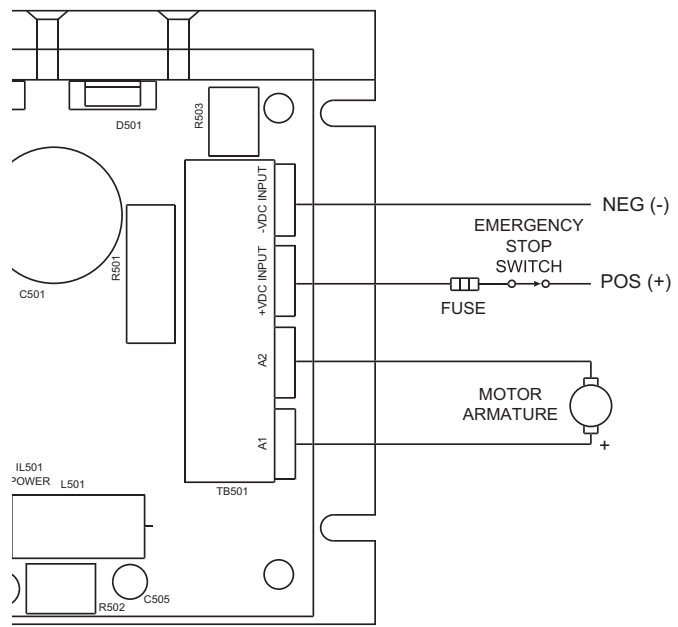


Figure 5. Power, Fuse and Motor Armature Connections

Voltage follower

Instead of using a speed adjust potentiometer, the drive may be wired to follow 0–10 VDC signal (Figure 6). Connect the signal input (+) to S2. Connect the signal common (–) to S1. S1 is at the same potential as -VDC. Make no connection to S3. A potentiometer can be used to scale the analog input voltage.

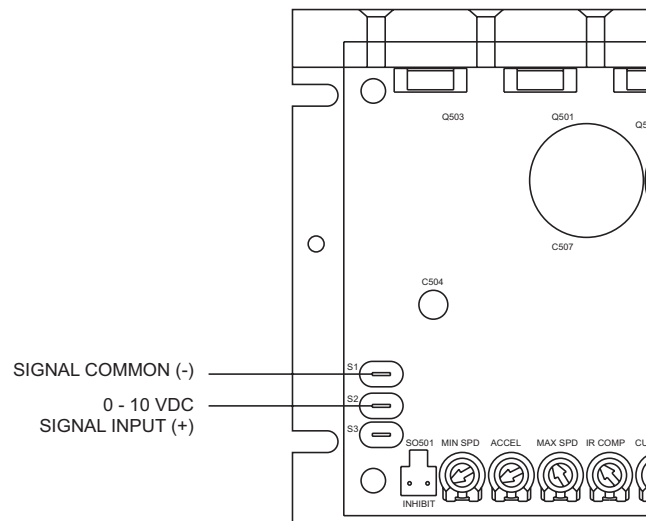


Figure 6. Voltage Follower Connections

Operation



Warning

Dangerous voltages exist on the drive when it is powered, and up to 30 seconds after power is removed and the motor stops. BE ALERT. High currents can cause serious or fatal injury. For your safety, use personal protective equipment (PPE) when operating this drive.

Before applying power

- Verify that no conductive material is present on the printed circuit board.
- Ensure that all jumpers are properly set.

Startup and shutdown

To start the drive:

1. Turn the speed adjust potentiometer full counterclockwise (CCW), or set the voltage signal to zero.
2. Apply DC voltage input.
3. Slowly advance the speed adjust potentiometer clockwise (CW), or increase the voltage signal. The motor slowly accelerates as the potentiometer is turned CW or the voltage signal is increased. Continue until the desired speed is reached.
4. Remove DC voltage input from the drive to coast the motor to a stop.

If the motor or drive does not perform as described, disconnect the DC voltage input immediately. Refer to the Troubleshooting section (page 31) for further assistance.

Starting and stopping methods



Warning!

Decelerating to minimum speed or coasting to a stop is recommended for frequent starts and stops. Do not use any of these methods for emergency stopping. They may not stop a drive that is malfunctioning. Removing DC line power is the only acceptable method for emergency stopping.

For this reason, **Bison strongly recommends installing an emergency stop switch** (see Figure 5, page 11).

Frequent decelerating to minimum speed produces high torque. This may cause damage to motors, especially gearmotors that are not properly sized for the application.

Automatic restart upon power restoration

All drives automatically run to set speed when power is applied.

Line starting and line stopping

Line starting and line stopping (applying and removing DC voltage input) is recommended for infrequent starting and stopping of a drive only. When DC voltage input is applied to the drive, the motor accelerates to the speed set by the speed adjust potentiometer. When DC voltage input is removed, the motor coasts to a stop.

Decelerating to minimum speed

A single pole, single throw switch may be used to decelerate a motor to minimum speed (see Figure 7). Close the switch between S1 and S2 to decelerate the motor from set speed to minimum speed. Open the switch to accelerate the motor from minimum speed to set speed. The ACCEL trimpot setting determines the rate at which the motor accelerates.

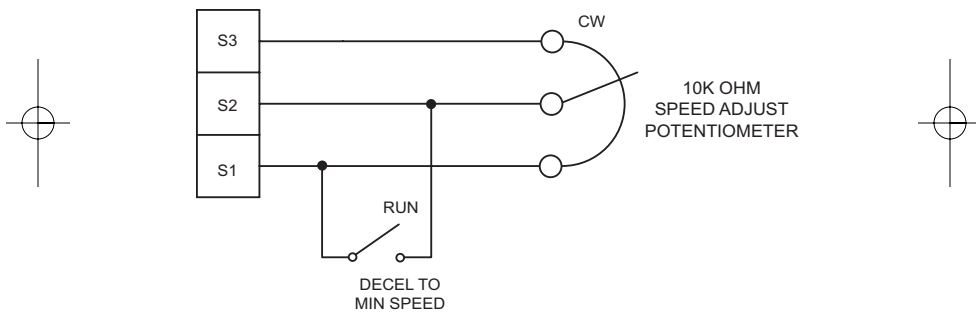


Figure 7. Run/Decelerate to Minimum Speed Switch

Inhibit terminals

Short the INHIBIT terminals to coast the motor to zero speed (see Figure 8 for INHIBIT terminal location). Reopen the INHIBIT terminals to accelerate the motor to set speed.

Twist inhibit wires and separate them from other power-carrying wires or sources of electrical noise. Use shielded cable if the inhibit wires are longer than 18 inches (46 cm). If shielded cable is used, ground only one end of the shield to earth ground. Do not ground both ends of the shield. See Shielding Guidelines, page 5.

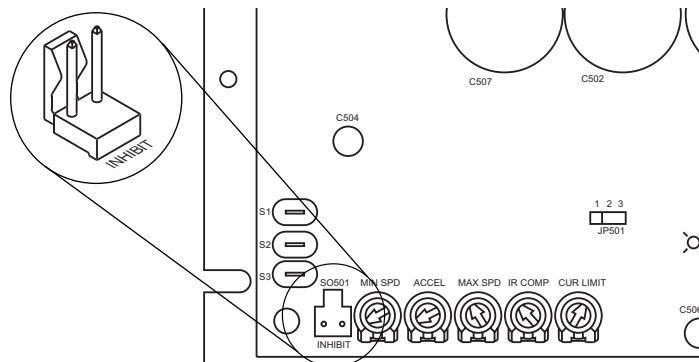


Figure 8. Inhibit Terminals

Power LED (IL501)

The power LED (IL501) lights whenever DC line voltage is applied to the drive. See Figure 9 below for the power LED location.

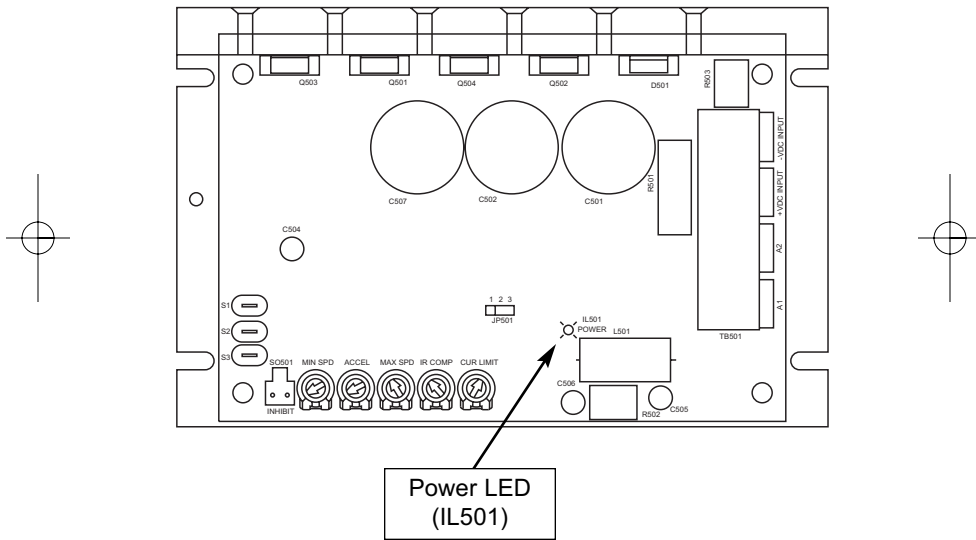


Figure 9. Power LED

Calibration

Warning

Dangerous voltages and currents exist on the drive when it is powered, and up to 30 seconds after power is removed and the motor stops. When possible, disconnect the voltage input from the drive before adjusting the trimpots. If the trimpots must be adjusted with power applied, use insulated tools and the appropriate personal protection equipment. BE ALERT. High voltages and currents can cause serious or fatal injury.

Each drive is factory calibrated to its maximum armature voltage and current rating. Readjust the calibration trimpot settings to accommodate a motor with a lower armature voltage and current rating.

All adjustments increase with clockwise rotation (CW), and decrease with counter-clockwise rotation (CCW). Use a non-metallic screwdriver for calibration. Each trimpot is identified on the printed circuit board (see Figure 10).

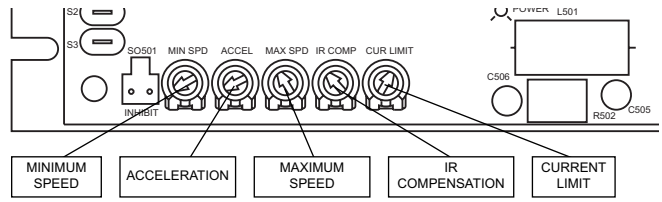


Figure 10. Calibration Trimpot Layout

MINIMUM SPEED (MIN SPD)

The MIN SPD setting determines the motor speed when the speed adjust potentiometer is turned full CCW. It is factory set for zero speed.

To calibrate MIN SPD:

1. Set the MAX SPD trimpot to full CW.
2. Set the MIN SPD trimpot to full CCW.
3. Turn the main speed adjust potentiometer to full CCW. If an input voltage is used instead of a speed adjust potentiometer, set the input signal to minimum.
4. Adjust the MIN SPD trimpot until the desired minimum motor speed is reached.

MAXIMUM SPEED (MAX SPD)

The MAX SPD setting determines the motor speed when the speed adjust potentiometer is turned full CW. It is factory set for maximum rated speed.

To calibrate MAX SPD:

1. Set the MAX SPD trimpot full CCW.
2. Apply power to the drive and turn the speed adjust potentiometer full CW. If an input voltage signal is used instead of a speed adjust pot, set the input signal to maximum.
3. Adjust the MAX SPD trimpot until the desired maximum motor speed is reached.

ACCELERATION (ACCEL)

The ACCEL setting determines the time the motor takes to accelerate to a higher speed. See **Specifications** on page 1 for approximate acceleration times. The ACCEL setting is factory set to its minimum value (full CCW).

To calibrate ACCEL:

1. Set the ACCEL trimpot full CCW.
2. Apply power to the drive and turn the main speed adjust potentiometer full CW. If an input voltage signal is used instead of a speed adjust pot, set the input signal to maximum. Note the time that the drive takes to accelerate to the desired speed.
3. Adjust the ACCEL trimpot until the desired acceleration time is reached. Turn the ACCEL trimpot CW to increase the acceleration time, and CCW to decrease the acceleration time.

IR COMPENSATION (IR COMP)

The IR COMP setting determines the degree to which motor speed is held constant as the motor load changes. It is factory set for optimum motor regulation.

Use the following procedure to recalibrate the IR COMP setting :

1. Set the IR COMP trimpot to minimum (full CCW).
2. Rotate the speed adjust potentiometer until the motor runs at midspeed without load (for example, 900 RPM for an 1800 RPM motor). A hand held tachometer may be used to measure motor speed.
3. Load the motor armature to its full load armature current rating. The motor should slow down.
4. While keeping the load on the motor, rotate the IR COMP trimpot until the motor runs at the speed measured in step 2. If the motor oscillates (overcompensation), the IR COMP trimpot may be set too high (CW). Turn the IR COMP trimpot CCW to stabilize the motor.
5. Unload the motor.

CURRENT LIMIT (CUR LIMIT)



Warning

CURRENT LIMIT should be set to 120% of motor nameplate current rating. Continuous operation beyond this setting may damage the motor. If you intend to operate beyond the rating, contact your Bison representative.

The CURRENT LIMIT setting determines the maximum armature current output of the drive.

Recalibrate the CUR LIMIT setting when a lower current limit is required. Refer to the CUR LIMIT settings in Figure 11, page 24, or recalibrate using the following procedure:

1. With the power disconnected from the control, connect a DC ammeter in series with the armature.
2. Set the CUR LIMIT trimpot to minimum (full CCW).
3. Set the speed adjust potentiometer to maximum (full CW).
4. Carefully lock the motor armature. Be sure that the motor is firmly mounted.
5. Apply line power. The motor should be stopped.
6. Slowly adjust the CUR LIMIT trimpot CW slowly until the armature current is 120% of motor rated armature current.
7. Set the speed adjust potentiometer, or input voltage to minimum.
8. Remove the power from the drive and unlock the motor shaft.
9. Remove the ammeter in series with the motor armature if it is no longer needed and re-apply power to the drive.

170-205-0016



 
 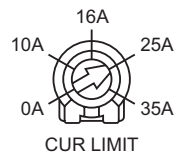


Figure 11. Approximate CUR LIMIT Settings

 

Application Notes

Multiple fixed speeds

Replace the speed adjust potentiometer with series resistors with a total series resistance of 10K ohms (Figure 12). Add a single pole, multi-position switch with the correct number of positions for the desired number of fixed speeds.

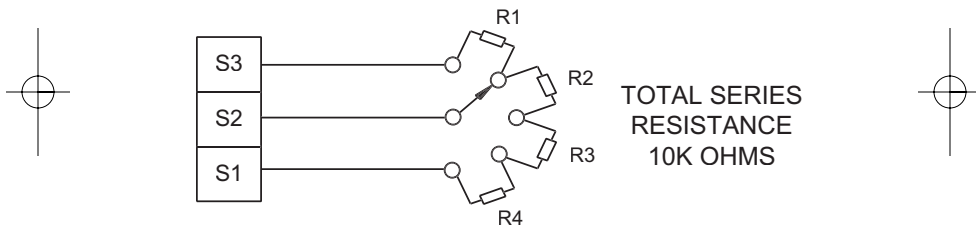


Figure 12. Multiple Fixed Speeds

Adjustable speeds using potentiometers in series

Replace the speed adjust potentiometer with a single pole, multi-position switch, and two or more potentiometers in series, with a total series resistance of 10K ohms. Figure 13 shows a connection for fixed high and low speed adjust potentiometers.

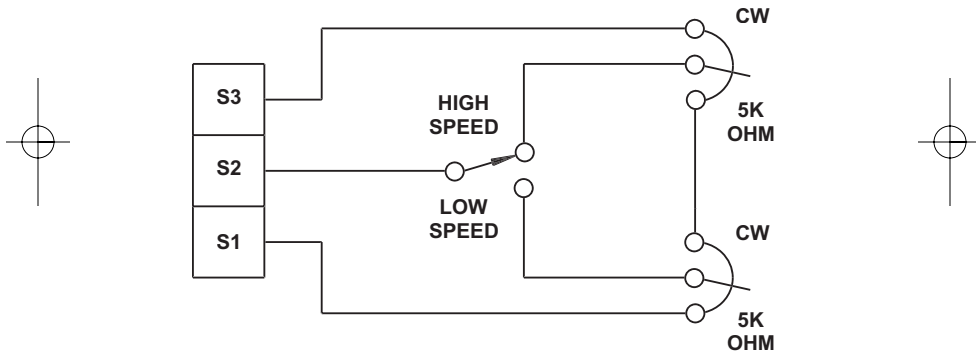


Figure 13. Adjustable Fixed Speeds Using Potentiometers in Series

Independent adjustable speeds

Replace the speed adjust potentiometer with a single pole, multi-position switch, and two or more potentiometers in parallel, with a total parallel resistance of 10K ohms. Figure 14 shows the connection of two independent speed adjust potentiometers that can be mounted at two separate operating stations.

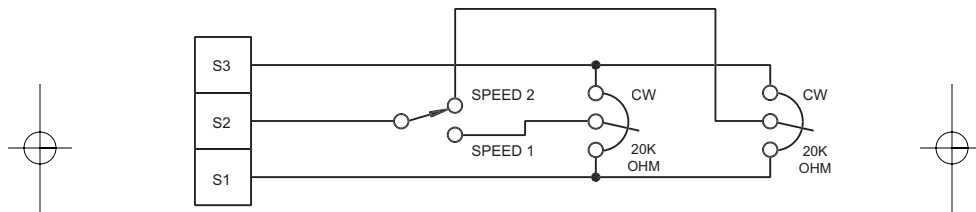


Figure 14. Independent Adjustable Speeds

RUN/JOG switch

Using a RUN/JOG switch is recommended in applications where quick stopping is not needed and frequent jogging is required. Use a single pole, two position switch for the RUN/JOG switch, and a normally closed, momentary operated pushbutton for the JOG pushbutton (see Figure 15). When the RUN/JOG switch is set to JOG, the motor decelerates to minimum speed. Press the JOG pushbutton to jog the motor. Return the RUN/JOG switch to RUN for normal operation.

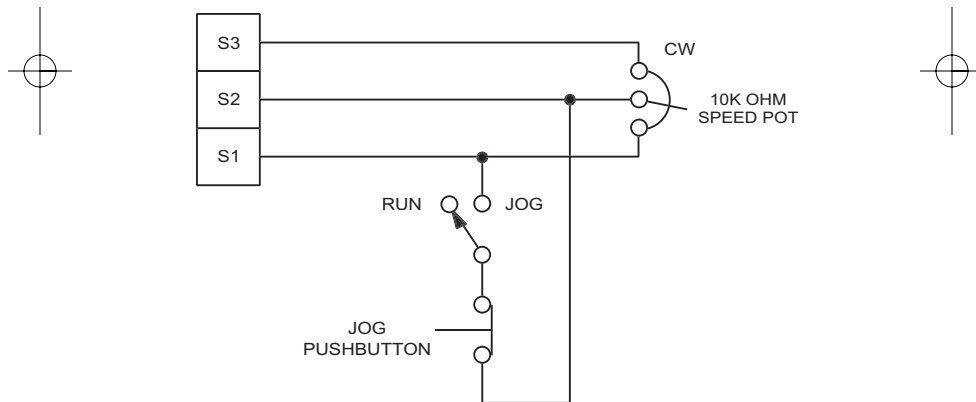

 
 


Figure 15. RUN/JOG Switch Connection to Speed Adjust Potentiometer

Reversing

Relays may be used in place of a switch, but a neutral position must be provided to prevent plug reversing (see Figure 16, page 30). **DO NOT CHANGE DIRECTIONS WHILE THE MOTOR IS STILL RUNNING.** Plug reversing the motor (not allowing the motor to come to a stop before reversing) will cause excessively high currents to flow in the armature circuit, which can damage the control and/or motor and is not recommended.

 

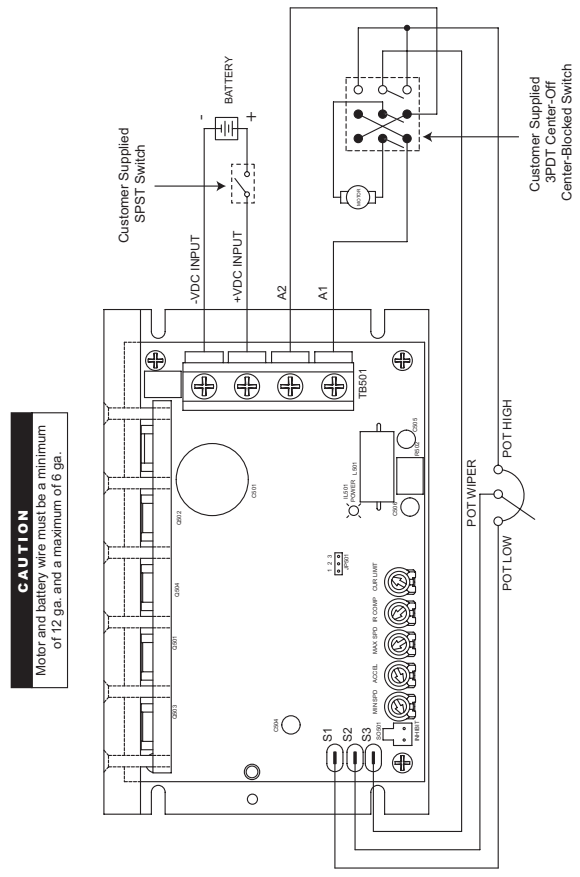


Figure 16. Reversing hookup diagram

Troubleshooting



Warning

Dangerous voltages and currents exist on the drive when it is powered, and up to 30 seconds after power is removed and the motor stops. When possible, disconnect the drive while troubleshooting. High voltages and currents can cause serious or fatal injury.

Before troubleshooting

Perform the following steps before starting any procedure in this section:

1. Disconnect DC voltage input from the drive.
2. Check the drive closely for damaged components.
3. Check that no conductive or other foreign material has become lodged on the printed circuit board.
4. Verify that all connections are correct and in good condition.
5. Verify that there are no short circuits or grounded connections.
6. Check that the drive's rated armature voltage and current is consistent with the motor ratings.

For additional assistance, contact your local Bison distributor, or the factory direct:




Phone: 1-800-AT-BISON

32



| Symptom | Possible Causes | Suggested Solutions |
|---|---|--|
| Line fuse blows | <ol style="list-style-type: none"> 1. Line fuses are the wrong size. 2. Motor cable or armature is shorted to ground. 3. Nuisance tripping caused by a combination of ambient conditions and high-current spikes. | <ol style="list-style-type: none"> 1. Check that line fuses are the correct size. 2. Check motor cable and armature for shorts. 3. Add a blower to cool the drive components; decrease CUR LIMIT settings, or resize motor and drive for actual load demand, or check for incorrectly aligned mechanical components for "jams". See page 23 for information on adjusting the CUR LIMIT trimpot. |
| Line fuse does not blow, but the motor does not run | <ol style="list-style-type: none"> 1. Speed adjust pot or reference voltage is set to zero speed. 2. Speed adjust pot or reference voltage connections are open. 3. Drive is overloaded. 4. Drive is not receiving DC line voltage. | <ol style="list-style-type: none"> 1. Increase speed adjust pot or reference voltage setting. 2. Check that the speed adjust pot or reference voltage connections are not open. 3. Verify that the motor is not jammed. Increase CURR LIMIT setting. 4. Apply DC line voltage to +VDC and -VDC. |

| Symptom | Possible Causes | Suggested Solutions |
|---|---|--|
| Line fuse does not blow, but the motor does not run (cont.) | 5. Motor is not connected. | 5. Connect motor to A1 and A2. |
| Motor runs too fast at maximum speed setting | 1. MIN SPD and MAX SPD settings are too high. | 1. Recalibrate MIN SPD and MAX SPD. |
| Motor runs too slow or too fast | 1. MIN SPD and MAX SPD are not calibrated. | 1. Recalibrate MIN SPD and MAX SPD |
| Motor will not reach the desired speed. | 1. MAX SPD setting is too low. 2. IR COMP setting is too low. 3. Motor is overloaded. | 1. Increase MAX SPD setting. 2. Increase IR COMP setting. 3. Check motor load. Resize the motor and drive if necessary. |
| Motor pulsates or surges under load. | 1. IR COMP is set too high. 2. Control is in current limit mode. | 1. Adjust the IR COMP setting slightly CCW until the motor speed stabilizes. 2. Check that motor and drive are of sufficient horsepower and amperage. |

 
 
 
Notes



Notes

  

Notes

   

Bison Warranty Policy

The Company warrants to the Buyer the products sold hereunder to be free of defects in material and workmanship under normal use and service for a period of one (1) year from the date of shipment. The obligation of the Company under this warranty is limited to repair or replacing at its option, any part or parts, which upon examination shall disclose to the reasonable satisfaction of the Company to have been defective in material or workmanship. Buyer must return the products to the Company's factory, shipping charges prepaid, and with complete information as to alleged defects and the installation, operation and service of the products. Except as otherwise expressly stated herein the Company makes no representation of warranty of any kind, express or implied, as to merchantability, fitness for a particular purpose, or any other matter with respect to the products sold hereunder.



Bison Gear & Engineering Corp.
3850 Ohio Ave. -- St. Charles, IL 60174
Phone: 1-800-AT-BISON
www.bisongear.com

Document Number: 250-0419; Revision 0 -- May 2006